




## Slatted deck – Fixing grating to bearers with sunked nuts

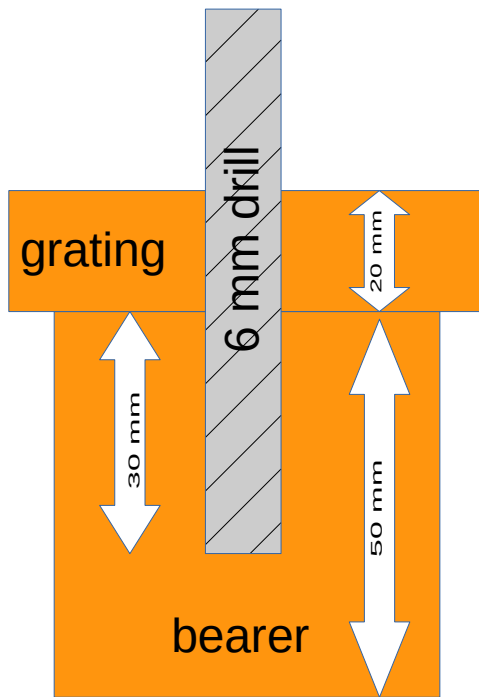


Position grating and bearer and drill  $20+30=50$  mm deep to screw size

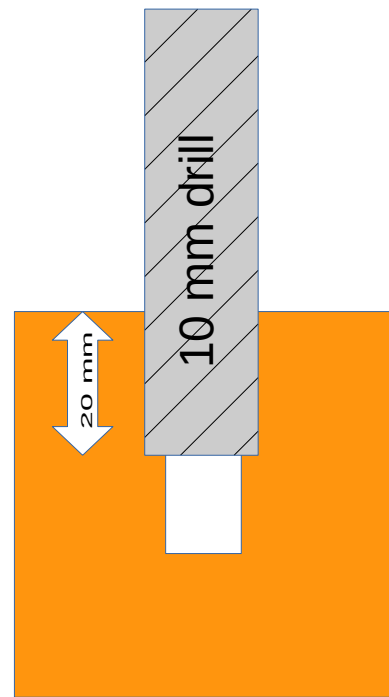

Take off grating and enlarge hole 20 mm deep to nut size

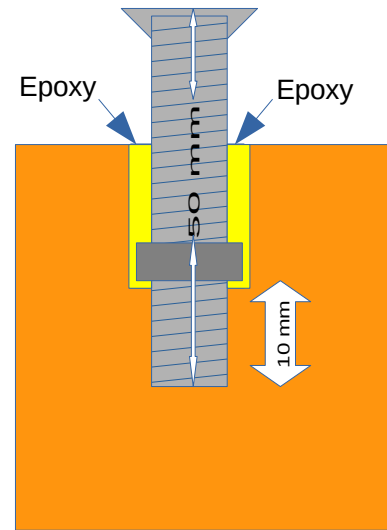

Insert screws with nut into epoxy filling; ensure to insert down into screw size hole for correct positioning. Before epoxy is fully cured, re-move screws, otherwise heat screws for removing.

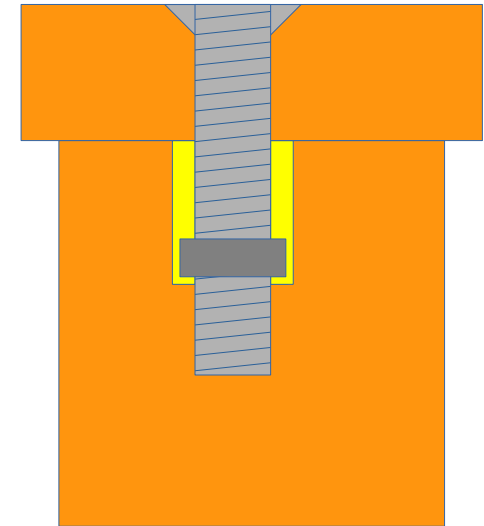

Screw grating onto bearers through the nuts